 
 


Instruction Manual

 
- ① Remove the stopper before installation.




- ② Insert cable into strain relief boot, strip off 1.2 inch of cable jacket, fold back braid and drain wire.




- ③ Fan out all four twisted pairs, following the color coding label and allocate each conductor into proper slots on wiring cap. Trim the ends of conductors.




- ④ Place wiring cap on plug.

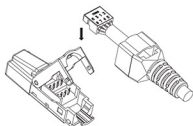

 - ⑤ Place the wiring cap onto plug, use plier to clamp wiring cap until it completely snap-in to effect the connection.




 - ⑥ Close plug cover, make sure the drain wire is in proper contact with grounding clip on plug. Pull back strain relief boot to cover the plug, fasten supplied cable tie to secure grounding contact.



Unload the cable

 Cut off cable tie, remove the boot. Using flat screw driver and pry gently on plug cover one end first and the other end subsequently to open it.



JACK PIN DESIGNATIONS	TIA/EIA T568A	TIA/EIA T568B	INDUSTRIAL
1	White/Green	White/Orange	Yellow
2	Green	Orange	Orange
3	White/Orange	White/Green	White
4	Orange	Green	Blue
5	Blue	Blue	
6	White/Blue	White/Blue	
7	White/Brown	White/Brown	
8	Brown	Brown	

Boot adjustment

Cut the end of boot to fit your cable OD.

